



AI Noor Auto Care

100-POINT INSPECTION · PRE-SALE INSPECTION REPORT


Report no.

PS-20261010-3456

2026-10-10

2021 Toyota Land Cruiser

GXR V6 · Pearl white · GCC spec

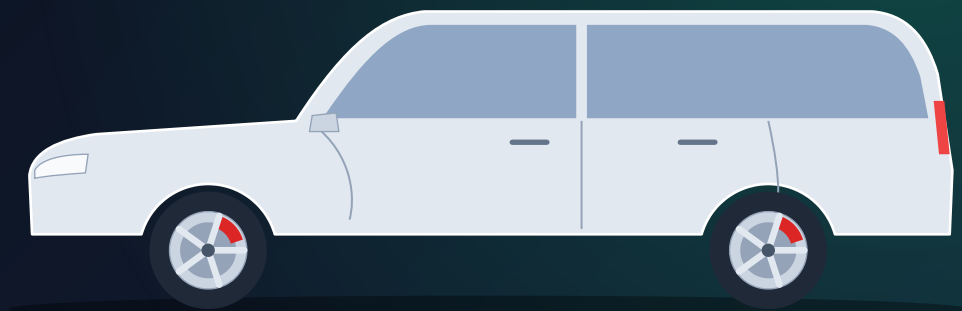

A+

Excellent

Excellent condition — ready to sell

100% checked · Final

VIN / CHASSIS NO.

JTMHV05J804123456

PLATE

4521 AB

ODOMETER (KM)

68,420 km

BODY TYPE

SUV

FUEL

Petrol

GEARBOX

Automatic

SELLER / OWNER

Private seller

INSPECTOR

Salim Al Harthy

LOCATION

**AI Noor Auto Care, Mus
cat**

AT A GLANCE



12/13

original paint



93%

avg tyre health



0

fault codes



0

critical

✓ 4 panel(s) factory paint protected with PPF

SCORE BY SYSTEM

94

Body & paint

16.9 / 18 pts · 15/15

93

Tires & wheels

9.3 / 10 pts · 4/4

100

Structure & accident

12 / 12 pts · 9/9

97

Engine & cooling

14.5 / 15 pts · 13/13

100

Gearbox & drivetrain

9 / 9 pts · 6/6

92

Brakes, steering & suspension

8.3 / 9 pts · 9/9

100

Electrical & A/C

5 / 5 pts · 10/10

100

Diagnostics (OBD scan)

10 / 10 pts · 15/15

98

Interior & safety


6.9 / 7 pts · 12/12

100

Road test

5 / 5 pts · 7/7

BODY & PAINT MAP

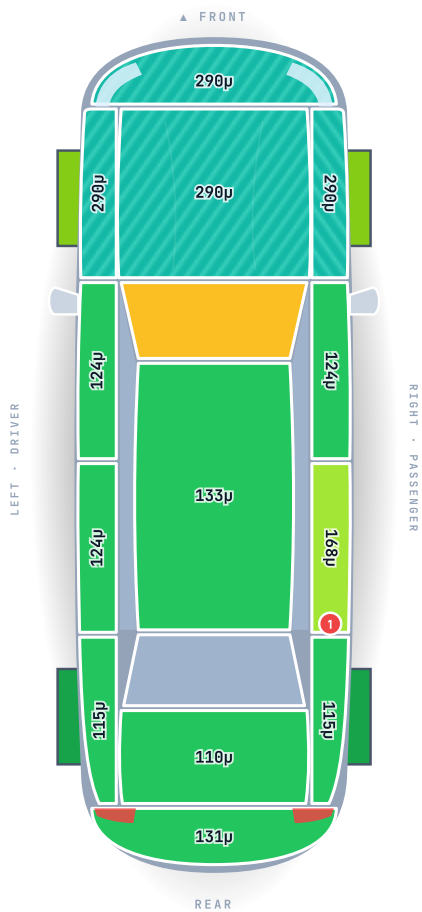


OEM + PPF	4	OEM original	8
Touch-up / smart repair	1	Repainted	0
Body filler / heavy repair	0	Replaced panel	0

POSITION	PAINT STATUS	MM
Front bumper	OEM + PPF	290
Hood / bonnet	OEM + PPF	290
Front right fender	OEM + PPF	290
Front right door	OEM original	124
Rear right door	Touch-up / smart repair +1	168
Rear right quarter	OEM original	115
Rear bumper	OEM original	131
Trunk / tailgate	OEM original	110
Rear left quarter	OEM original	115
Rear left door	OEM original	124
Front left door	OEM original	124
Front left fender	OEM + PPF	290
Roof	OEM original	133

TIRES

POSITION	TREAD DEPTH	DOT	AGE	BRAND / SIZE	DEFECTS	TIRE HEALTH
FL Front left	5.5 mm	1424	2.5 yrs	Bridgestone Dueler 285/60 R18		85%
FR Front right	5.5 mm	1424	2.5 yrs	Bridgestone Dueler 285/60 R18		85%
RL Rear left	7 mm	1424	2.5 yrs	Bridgestone Dueler 285/60 R18		100%
RR Rear right	7 mm	1424	2.5 yrs	Bridgestone Dueler 285/60 R18		100%

WHERE THE FINDINGS ARE

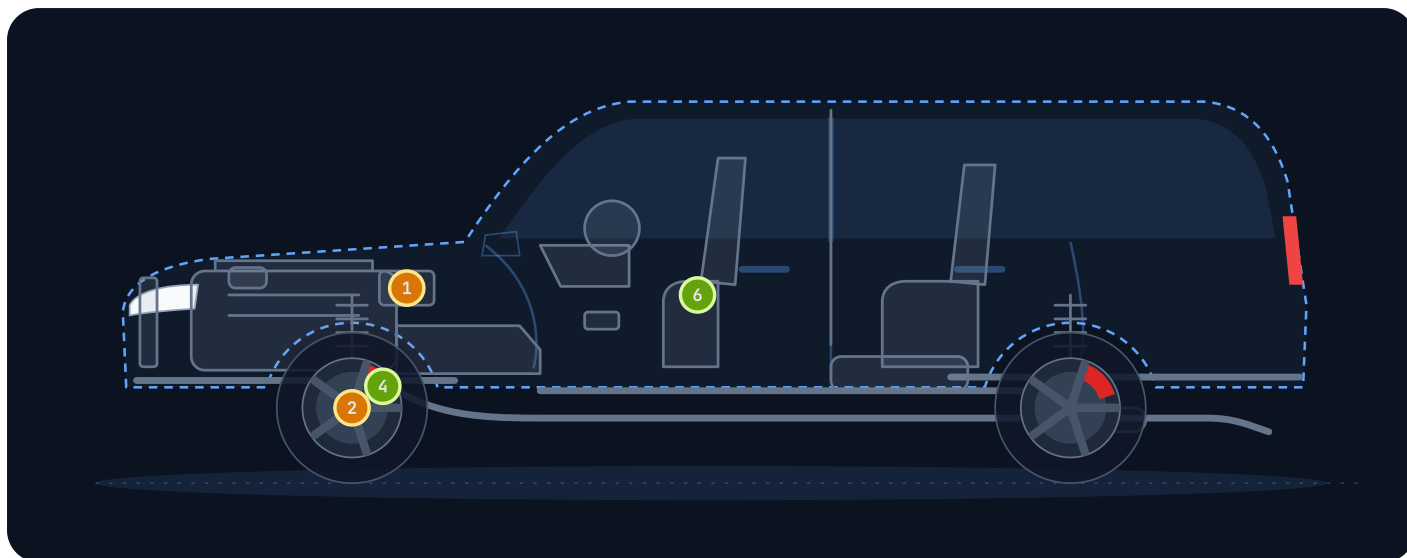

Numbers match the findings list below. Body panel findings are shown on the paint map.

FINDINGS & DEDUCTIONS

-1.8 pts

PLAN SOON 3

1 ENGINE & COOLING

Battery

12.2–12.4 V

-0.5

2 BRAKES, STEERING & SUSPENSION

Tracking / alignment

Pulls / wheel off-centre

-0.4

4 BRAKES, STEERING & SUSPENSION

Brake pads

3–6 mm

-0.3

COSMETIC / MINOR 3

3 BODY & PAINT

Rear right door

Touch-up / smart repair · Light scratch

Small smart repair near the handle, colour match is good.

-0.3

5 BODY & PAINT

Windshield

Stone chip

-0.2

6 INTERIOR & SAFETY

Seats & upholstery

Normal wear

-0.1

FULL CHECKLIST

Structure & accident

Front chassis rails & apron	Original, untouched
Rear chassis & boot floor	Original, untouched
Pillars & sills (A/B/C)	Factory spot-welds
Airbags & SRS	Original, light off
Flood / water signs	No signs
Underbody rust	Clean
VIN / chassis number match	All match, untouched
Import / salvage history	Clean report / GCC history
Hinge & fender bolts, door seals	Factory paint on bolts, seals clean

Engine & cooling

Cold start & idle	Starts instantly, smooth
Engine oil	Full & clean
Oil leaks	Dry
Coolant & radiator	Correct level & colour
Exhaust smoke	Clear
Belts & hoses	Good
Engine mounts	Firm
Battery	12.2–12.4 V
Turbo / supercharger	No whine, no oil in intake
Air filter & sand ingress	Clean, sealed
Cooling fan & temperature	Fan cycles, temp stable
Exhaust & catalytic converter	Sealed, quiet
Injectors & misfire	Smooth, no misfire

Gearbox & drivetrain

Shift quality (road test)	Smooth, on time
Gearbox fluid	Clean red
4WD / AWD engagement	Engages all modes
CV joints & boots	Boots intact, silent
Differential / transfer leaks	Dry
Gearbox mount	Firm, no clunk

Brakes, steering & suspension

Brake pads	3–6 mm
Brake discs	Smooth
Braking (road test)	Straight & firm
Shock absorbers	Dry, controlled
Steering rack & play	Tight, centred
Bushings & ball joints	Tight
Tracking / alignment	Pulls / wheel off-centre
Wheel bearings	Silent, no play
Parking brake	Holds firmly

Electrical & A/C

A/C vent temperature	≤ 8 °C — strong
Dashboard warning lights	None after start
Exterior lights	All working
Windows, locks & mirrors	All working
Screen, camera & sensors	All working
Keys & remotes	2 keys, working
A/C compressor & condenser	Quiet, no leaks
Charging system (alternator)	13.8–14.7 V
Hybrid / EV battery	Healthy, cells balanced
Horn, wipers & washers	All working

Diagnostics (OBD scan)

Engine (ECM)	No codes
Transmission (TCM)	No codes
ABS / ESC brakes	No codes
Airbags (SRS)	No codes
Body control (BCM)	No codes
Climate control (HVAC)	No codes
Power steering (EPS)	No codes
Tyre pressure (TPMS)	No codes
4WD / AWD / transfer	No codes
Hybrid / EV system	No codes
ADAS (camera / radar)	No codes
Network (U-codes)	No codes
Readiness monitors	All ready
Module mileage vs dashboard	Matches
Live data	All values normal

Interior & safety

Seats & upholstery	Normal wear
Dashboard & trim	Clean, no cracks
Headliner & carpets	Clean
Cabin smell	Neutral
Seat belts	All latch & retract
Mileage vs wear	Consistent
Spare, jack & tools	Complete
Service history	Full agency history
Recalls & campaigns	None open
Seat adjust, heating & cooling	All functions work
Child locks & rear window lock	Working
Sunroof & drains	Smooth, drains clear

Road test

Acceleration & power	Strong, smooth pull
Vibration at speed	None
Clunks & rattles	Quiet
Steering feel & return	Precise, self-centres
Wind & road noise	Normal for the model
After the drive (hot check)	Stable, dry, no smells
Cruise control & driver aids	All working

Inspector: Salim Al Harthy

Customer: Private seller

Signature

Signature

This report records the visible and tested condition on the inspection date. Points are an internal condition rubric, not a warranty, certification or legal roadworthiness test. Hidden or internal faults may not be detectable without dismantling.